

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Asset: P.S. 16 - BROOKLYN, 157 WILSON STREET, New York, 11211

Inspection Id	Inspection Type	Time In	Last Edited
EE : K016	Electrical	2023-11-10 7:44 AM	2023-11-14 9:33 AM

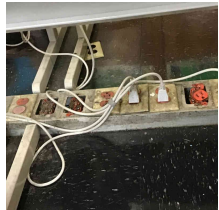
Asset Data

Question	Answer
Type of Service	Below Ground
Does Interactive Whiteboard (IWB) Exist?	Yes
Water Penetration in Electrical Room?	No
Have any Systems/Major Building Components been upgraded?	Yes
	Systems: Fire Alarm System (CO Detectors), LAN
	Years: 2022
	Systems: Fire Alarm System
	Years: 2019
	Systems: Intrusion Alarm System (Panic Switch)
	Years: 2018
	Systems: Interior Lighting - Except (Auditorium, Library, Cafeteria)
	Years: 2014
	Systems: Cafeteria (Lighting)
	Years: 2011
	Systems: Security Lights
	Years: 2008
	Systems: Service Switch
	Years: 2007, 2009
	Systems: Public Address System, Local Sound System, Auditorium, Library, Switchboard, Emergency Light/Exit Light Panel
	Years: 2007
	Systems: Molded Case Circuit Breaker Type Panel Board, Fused Disconnect Switch Type Panel Board
	Years: 1999, 2007

DEDICATED INTERCOMS IN FIRE RESCUE AREAS

Question	Response
Are there any Life Rescue Assistance Areas, Fire Rescue Areas, and/or Holding Rooms in your building?	No

Priority Condition

Priority Condition Exist Last Year?	Priority Category	Condition Description	Component Affected	Location Description	Person(s) Notified	Person(s) Title	Status	PhotoImage
No	Fire Alarm System - Defective	The Fire Alarm System Main Panel was in trouble mode because one of the phone lines was disconnected.	FIRE ALARM SYSTEM Main Panel Fire Alarm Control Panel (Electronic)	Main Entrance Lobby	Robert Bobko	Custodian	Sent to DSF	
Yes	Exposed Electrical Wires	Some outlets have physical damage, resulting in exposed electrified sockets.	Raceway With Receptacles	Computer Lab - Room 229	Robert Bobko	Custodian	Sent to DSF	

Inspection

Question	Response
Electrical	

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
AUDITORIUM	Inspected
Instance on 1st Floor	Inspected
House Lighting	Inspected
Does a Chandelier exist?	No
Instance on 1st Floor	Inspected
Lighting Fixture - Fluorescent	
Instance on 1st Floor	Inspected
Pendant Mounted	Inspected
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	LIGHTING FIXTURE BALLAST DEFECTIVE
Deficiency Quantity	2
Quantity Uom	EACH
Potential Action	REPLACE BALLAST
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
Surface Mounted	Does not Exist
Instance on 1st Floor	Does not Exist
Recessed Mounted	Does not Exist
Instance on 1st Floor	Does not Exist
Lighting Fixture - HID	
Instance on 1st Floor	Does not Exist
Lighting Fixture - Incandescent	
Instance on 1st Floor	Does not Exist
Lighting Fixture - LED	
Instance on 1st Floor	Does not Exist
Local Sound System	Inspected
Instance on 1st Floor	Inspected
Installation Year	2007
Source of Installation	Inspector Estimate
Condition	3 - Fair
Deficiency	No deficiencies recorded
Projection System	Inspected
Is the projector on a cart or installed on the ceiling?	Ceiling
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Theater Lighting System	Inspected
Instance on 1st Floor	Inspected
Dimming System	
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Theater Lighting	
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
CAFETERIA	Inspected

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
CAFETERIA	
Instance on 1st Floor	Inspected
Lighting	Inspected
Instance on 1st Floor	Inspected
Lighting Fixture - Fluorescent	
Instance on 1st Floor	Inspected
Pendant Mounted	Does not Exist
Instance on 1st Floor	Does not Exist
Surface Mounted	Inspected
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	LIGHTING FIXTURE BALLAST DEFECTIVE
Deficiency Quantity	2
Quantity Uom	EACH
Potential Action	REPLACE BALLAST
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
Recessed Mounted	Inspected
Instance on 1st Floor	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Lighting Fixture - HID	
Instance on 1st Floor	Does not Exist
Lighting Fixture - Incandescent	
Instance on 1st Floor	Does not Exist
Lighting Fixture - LED	
Instance on 1st Floor	Does not Exist
Local Sound System	Inspected
Instance on 1st Floor	Inspected
Installation Year	2007
Source of Installation	Inspector Estimate
Condition	3 - Fair
Deficiency	MICROPHONE / JACK NOT OPERATIONAL
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 2
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
Projection System	Does not Exist
Instance on 1st Floor	Does not Exist
Theater Lighting System	Does not Exist
Instance on 1st Floor	Does not Exist
CLASSROOM/CORRIDOR/ADMINISTRATIVE SPACE	Inspected
Lighting	Inspected
Does a Chandelier exist?	No

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
CLASSROOM/CORRIDOR/ADMINISTRATIVE SPACE	
Lighting	
Lighting Fixture - Fluorescent	Inspected
Pendant Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Surface Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Recessed Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Lighting Fixture - HID	Does not Exist
Lighting Fixture - Incandescent	Does not Exist
Lighting Fixture - LED	Does not Exist
COMPUTER LAB	Inspected
Instance on Room 229	Inspected
Power Panel	Yes
Lighting	Inspected
Instance on Room 229	Inspected
Lighting Fixture - Fluorescent	
Instance on Room 229	Inspected
Pendant Mounted	Inspected
Instance on Room 229	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Surface Mounted	Does not Exist
Instance on Room 229	Does not Exist
Recessed Mounted	Does not Exist
Instance on Room 229	Does not Exist
Lighting Fixture - HID	
Instance on Room 229	Does not Exist
Lighting Fixture - Incandescent	
Instance on Room 229	Does not Exist
Lighting Fixture - LED	
Instance on Room 229	Does not Exist
Raceway With Receptacles	Inspected
Instance on Room 229	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
GYMNASIUM	Inspected
Instance on 3rd Floor	Inspected
Lighting	Inspected
Instance on 3rd Floor	Inspected
Lighting Fixture - Fluorescent	
Instance on 3rd Floor	Does not Exist
Lighting Fixture - HID	
Instance on 3rd Floor	Does not Exist
Lighting Fixture - Incandescent	

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
GYMNASIUM	
Lighting	
Lighting Fixture - Incandescent	
Instance on 3rd Floor	Does not Exist
Lighting Fixture - LED	
Instance on 3rd Floor	Inspected
Pendant Mounted	Does not Exist
Instance on 3rd Floor	Does not Exist
Surface Mounted	Inspected
Instance on 3rd Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Recessed Mounted	Does not Exist
Instance on 3rd Floor	Does not Exist
Local Sound System	Inspected
Instance on 3rd Floor	Inspected
Installation Year	2007
Source of Installation	Inspector Estimate
Condition	3 - Fair
Deficiency	No deficiencies recorded
Projection System	Does not Exist
Instance on 3rd Floor	Does not Exist
Scoreboard	Does not Exist
Instance on 3rd Floor	Does not Exist
Theater Lighting System	Does not Exist
Instance on 3rd Floor	Does not Exist
KITCHEN	Inspected
Instance on 1st Floor	Inspected
Lighting	Inspected
Instance on 1st Floor	Inspected
Lighting Fixture - Fluorescent	
Instance on 1st Floor	Inspected
Pendant Mounted	Does not Exist
Instance on 1st Floor	Does not Exist
Surface Mounted	Inspected
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Recessed Mounted	Inspected
Instance on 1st Floor	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Lighting Fixture - HID	
Instance on 1st Floor	Does not Exist
Lighting Fixture - Incandescent	
Instance on 1st Floor	Does not Exist
Lighting Fixture - LED	
Instance on 1st Floor	Does not Exist
LIBRARY	Inspected

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
LIBRARY	
Instance on Room 233	Inspected
Lighting	Inspected
Instance on Room 233	Inspected
Lighting Fixture - Fluorescent	
Instance on Room 233	Inspected
Pendant Mounted	Inspected
Instance on Room 233	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Surface Mounted	Does not Exist
Instance on Room 233	Does not Exist
Recessed Mounted	Does not Exist
Instance on Room 233	Does not Exist
Lighting Fixture - HID	
Instance on Room 233	Does not Exist
Lighting Fixture - Incandescent	
Instance on Room 233	Does not Exist
Lighting Fixture - LED	
Instance on Room 233	Does not Exist
Raceway With Receptacles	Does not Exist
Instance on Room 233	Does not Exist
Projection System	Does not Exist
Instance on Room 233	Does not Exist
LOCKER ROOM	Inspected
Instance on 3rd Floor - Boys	Inspected
Alternative use	Yes
Instance on 3rd Floor - Girls	Inaccessible
Lighting	Inspected
Instance on 3rd Floor - Boys	Inspected
Lighting Fixture - Fluorescent	
Instance on 3rd Floor - Boys	Inspected
Pendant Mounted	Does not Exist
Instance on 3rd Floor - Boys	Does not Exist
Surface Mounted	Inspected
Instance on 3rd Floor - Boys	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Recessed Mounted	Does not Exist
Instance on 3rd Floor - Boys	Does not Exist
Lighting Fixture - HID	
Instance on 3rd Floor - Boys	Does not Exist
Lighting Fixture - Incandescent	
Instance on 3rd Floor - Boys	Does not Exist
Lighting Fixture - LED	
Instance on 3rd Floor - Boys	Does not Exist
MULTIPURPOSE ROOM	Does not Exist
SCIENCE DEMO ROOM	Does not Exist
SCIENCE LAB	Does not Exist

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
SCIENCE PREP ROOM	Does not Exist
SWIMMING POOL	Does not Exist
TOILET ROOM - STAFF	Inspected
Lighting	Inspected
Lighting Fixture - Fluorescent	Inspected
Pendant Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Surface Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Recessed Mounted	Does not Exist
Lighting Fixture - HID	Does not Exist
Lighting Fixture - Incandescent	Does not Exist
Lighting Fixture - LED	Does not Exist
TOILET ROOM - STUDENT	Inspected
Lighting	Inspected
Lighting Fixture - Fluorescent	Inspected
Pendant Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Surface Mounted	Inspected
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Recessed Mounted	Does not Exist
Lighting Fixture - HID	Does not Exist
Lighting Fixture - Incandescent	Does not Exist
Lighting Fixture - LED	Does not Exist
AUXILIARY SIGNAL/BELL SYSTEM	Inspected
Replacement Quantity	101,000
Replacement Uom	S.F.
Condition	3 - Fair
Deficiency	No deficiencies recorded
EMERGENCY DC STANDBY BATTERY POWER	Does not Exist
EMERGENCY GENERATOR SET	Does not Exist
EMERGENCY LIGHT/EXIT LIGHT PANEL	Inspected
Condition	2 - Between Good and Fair
Deficiency	LESS THAN 20% SPARE CIRCUIT BREAKERS
Deficiency Location/Instance	Main Electrical Room
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	INSTALL NEW PANEL BOARD
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
EMERGENCY LIGHTING	Inspected
Battery Pack	Inspected

Electrical Inspection

Question

EMERGENCY LIGHTING

Condition

Condition	3 - Fair
Deficiency	BATTERY NOT OPERATIONAL
Deficiency Location/Instance	Main Entrance Lobby, Corridor - By Room 145
Deficiency Quantity	2
Quantity Uom	EACH
Potential Action	REPLACE BATTERY
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.

Inspected

Condition	3 - Fair
Deficiency	No deficiencies recorded

Inspected

Inspected

Condition	3 - Fair
Deficiency	FIXTURE NOT OPERATIONAL
Deficiency Location/Instance	Gymnasium
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.

Inspected

Condition	3 - Fair
Deficiency	FIXTURE LAMP NOT OPERATIONAL
Deficiency Location/Instance	Corridors - By Rooms (534, 520, 420, 418, 412, 321, 301, C7), 3rd Floor Corridor - By Staircase E, Boiler Room
Deficiency Quantity	22
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.

Does not Exist

Inspected

Replacement Quantity	101,000
Replacement Uom	S.F.

Inspected

Condition	1 - Good
Deficiency	No deficiencies recorded

Inspected

Condition	1 - Good
Deficiency	No deficiencies recorded

Inspected

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
FIRE ALARM SYSTEM	
Manual Pull Station	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Fan Shutdown Control	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Duct Smoke Detector	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Area Smoke Detector	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
CO Detector	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Heat Detector	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Elevator Recall	Does not Exist
Magnetic Door Holder/Contactor	Does not Exist
Fused Cutout Panel	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Fire Alarm Digital Communicator	Does not Exist
Main Panel	Inspected
Bell At Panel	Does not Exist
Fire Alarm Control Panel (Electronic)	Inspected
Instance	Main Entrance Lobby
Instance Condition	2 - Between Good and Fair
Instance Quantity	1
Instance Quantity Uom	EACH
Instance Manufacturer	Edwards System Technology
Equipment	Fire Alarm Control Panel
Model	EST3X
Installation Year	2019
Source of Installation	Documented
Deficiency	SYSTEM DEFECTIVE
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	REPAIR SYSTEM
Urgency of Action	PRIORITY 5
Purpose of Action	LEVEL 6
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
Fire Alarm Control Panel (Standard)	Does not Exist
Sub-Panel	Does not Exist
Remote Annunciator	Inspected
Display Monitor	Does not Exist

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
FIRE ALARM SYSTEM	
Remote Annunciator	
Panel	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Printer	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Punch Register	Does not Exist
Sprinkler Flow/Air Pressure Switch	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Tamper Flow Switch/Chain	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
GROUNDING SYSTEM	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
INTERCOM SYSTEM	Does not Exist
LAN	Inspected
Local Distribution Frame (I/LDF)	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
Main Equipment Rack (MDF)	Inspected
Condition	1 - Good
Deficiency	No deficiencies recorded
LIGHTNING PROTECTION	Does not Exist
MOTOR CONTROLLER	Inspected
Motor Control Center	Does not Exist
Motor Starter/Contactor	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Variable Frequency Drive	Does not Exist
PANEL BOARD	Inspected
Fused Disconnect Switch Type	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Fused Knife Switch Type	Does not Exist
Fused Toggle Switch Type	Does not Exist
Molded Case Circuit Breaker Type	Inspected
Condition	3 - Fair
Deficiency	NO SPARE
Deficiency Location/Instance	Boiler Room
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	INSTALL NEW PANEL BOARD
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
PANEL BOARD	
Molded Case Circuit Breaker Type	
Violations	No violations recorded.
Deficiency	PANEL BOARD DOOR LOCK IS MISSING
Deficiency Location/Instance	Gymnasium
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
Deficiency	PANEL BOARD COVER IS MISSING
Deficiency Location/Instance	Cafeteria (Inside Closet)
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	MAINTENANCE
Urgency of Action	PRIORITY 2
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
PUBLIC ADDRESS SYSTEM	
	Inspected
Replacement Quantity	101,000
Replacement Uom	S.F.
Instance	General Office
Instance Condition	3 - Fair
Instance Quantity	1
Instance Quantity Uom	EACH
Model	Rauland Telecenter
Installation Year	2007
Source of Installation	Documented
Deficiency	CLOCK NOT OPERATIONAL
Deficiency Location/Instance	Classrooms and Corridors
Deficiency Quantity	27
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 3
Purpose of Action	LEVEL 2
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
SECURITY	
	Inspected
IPDVS/CCTV System	
	Does not Exist
Intrusion Alarm System	
	Inspected
Replacement Quantity	101,000
Replacement Uom	S.F.
Central Control Panel	
	Inspected
Instance	Custodian's Office
Instance Condition	3 - Fair

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
SECURITY	
Intrusion Alarm System	
Central Control Panel	
Instance Quantity	1
Instance Quantity Uom	EACH
Model	Vista-50P
Installation Year	1996
Source of Installation	Documented
Deficiency	No deficiencies recorded
Infrared Sensor	
Condition	3 - Fair
Deficiency	No deficiencies recorded
Panic Switch	
Condition	2 - Between Good and Fair
Deficiency	No deficiencies recorded
Remote Annunciator	
Condition	3 - Fair
Deficiency	No deficiencies recorded
Siren/Strobe	
Condition	3 - Fair
Deficiency	No deficiencies recorded
Lighting - Security	
Replacement Uom	EACH
Condition	3 - Fair
Deficiency	LIGHTING FIXTURE BALLAST DEFECTIVE
Deficiency Location/Instance	Roof - facing Wilson Street
Deficiency Quantity	1
Quantity Uom	EACH
Potential Action	REPLACE BALLAST
Urgency of Action	PRIORITY 2
Purpose of Action	LEVEL 3
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
Deficiency	LIGHTING FIXTURE PHOTOCCELL NOT OPERATIONAL
Deficiency Location/Instance	Exterior Wall - facing (Wilson Street, Playground)
Deficiency Quantity	2
Quantity Uom	EACH
Potential Action	REPLACE
Urgency of Action	PRIORITY 2
Purpose of Action	LEVEL 3
Deficiency Photo1	No photo recorded
Violations	No violations recorded.
SERVICE SWITCH	
Instance	Electrical Room (Adjacent to Main Electrical Room)
Instance Condition	2 - Between Good and Fair
Instance Quantity	1
Instance Quantity Uom	EACH
Instance Manufacturer	Delta Metal Product
Equipment	Service Switch A
Capacity/Size Quantity	800

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
SERVICE SWITCH	
Capacity/Size UOM	Amps
Source of Capacity/Size	Nameplate
Installation Year	2009
Source of Installation	Documented
Deficiency	No deficiencies recorded
Instance	Main Electrical Room
Instance Condition	2 - Between Good and Fair
Instance Quantity	1
Instance Quantity Uom	EACH
Instance Manufacturer	All City Switchboard
Equipment	Main Service Switch
Capacity/Size Quantity	1,200
Capacity/Size UOM	Amps
Source of Capacity/Size	Nameplate
Installation Year	2007
Source of Installation	Documented
Deficiency	No deficiencies recorded
SWITCHBOARD	Inspected
Number of Spares	0
Fused Disconnect Switch Type	Inspected
Instance	Boiler Room
Instance Condition	2 - Between Good and Fair
Instance Quantity	1
Instance Quantity Uom	EACH
Instance Manufacturer	General Electric
Equipment	Dist. Panel B Sec 1/ Dist. Panel B Sec 2
Capacity/Size Quantity	1,200
Capacity/Size UOM	Amps Total
Capacity/Size2 Quantity	2
Capacity/Size2 UOM	Section(S)
Source of Capacity/Size	Nameplate
Installation Year	2007
Source of Installation	Documented
Deficiency	No deficiencies recorded
Instance	Electrical Room (Adjacent to Main Electrical Room)
Instance Condition	2 - Between Good and Fair
Instance Quantity	1
Instance Quantity Uom	EACH
Instance Manufacturer	General Electric
Equipment	Dist. Panel A Sec 1/ Dist. Panel A Sec 2
Capacity/Size Quantity	800
Capacity/Size UOM	Amps Total
Capacity/Size2 Quantity	2
Capacity/Size2 UOM	Section(S)
Source of Capacity/Size	Nameplate
Installation Year	2007
Source of Installation	Documented
Deficiency	No deficiencies recorded

NYC Department of Education
Building Condition Assessment Survey 2023 - 2024

Electrical Inspection

K016

Question	Response
SWITCHBOARD	Inspected
Fused Knife Switch Type	Does not Exist
Molded Case Circuit Breaker Type	Does not Exist
TELEPHONE SYSTEM	Inspected
PBX/Intercom	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
Standard	Inspected
Condition	3 - Fair
Deficiency	No deficiencies recorded
TRANSFORMER	Does not Exist